



**GEOTECHNICAL & MATERIALS
ENGINEERING, TESTING & INSPECTION**
P.O. BOX 15732 • TAMPA, FLORIDA 33684 • 813/872-7821

CA No.1450

AGGREGATE ANALYSIS


PROJECT: Product Check **PROJECT NO.:** 1505.21.1
DATE: 1/6/2026
CLIENT: Pasco Mine **LAB NO.:** B-15865

SAMPLE LOCATION: Stockpile
SAMPLE DESCRIPTION: Coarse Aggregate – No. 57 Limestone

<u>Sieve Number</u>	<u>Percent Passing</u>	<u>FDOT Specifications Section 901-1.4</u>
1 1/2"	100	100
1"	100	95-100
3/4"	83	---
1/2"	41	25-60
3/8"	21	---
No. 4	7	0-10
No. 8	5	0-5

FINENESS MODULUS: 6.84

DATE SAMPLED: 12/11/2025
DATE RECEIVED: 12/11/2025
DATE TESTED: 12/22/2025
SAMPLED BY: CB
TESTED BY: CB

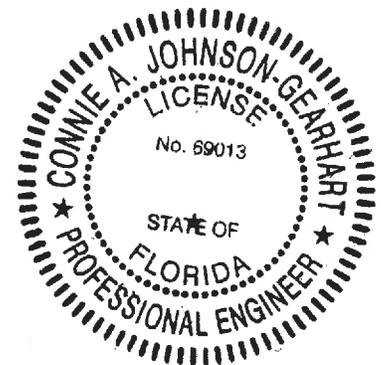

Connie A. Johnson-Gearhart
CONNIE A. JOHNSON-GEARHART, P.E. 1/6/26
 Florida License No. 69013