



GEOTECHNICAL & MATERIALS  
ENGINEERING, TESTING & INSPECTION  
P.O. BOX 15732 • TAMPA, FLORIDA 33684 • 813/872-7821

CA No.1450

## AGGREGATE ANALYSIS

**PROJECT:** Product Check

**PROJECT NO:** 1505.21.1

**DATE:** 7/2/2025

**CLIENT:** Pasco Mine

**LAB NO.:** B-15429

**SAMPLE LOCATION:** Stockpile

**SAMPLE DESCRIPTION:** Coarse Aggregate – No. 57 Limestone

<u>Sieve Number</u>	<u>Percent Passing</u>	<u>FDOT Specifications</u> <u>Section 901-1.4</u>
1 1/2"	100	100
1"	100	95-100
3/4"	91	---
1/2"	51	25-60
3/8"	25	---
No. 4	6	0-10
No. 8	5	0-5

**FINENESS MODULUS:** 6.72


**DATE SAMPLED:** 6/20/2025

**DATE RECEIVED:** 6/20/2025

**DATE TESTED:** 6/25/2025

**SAMPLED BY:** CB

**TESTED BY:** CB

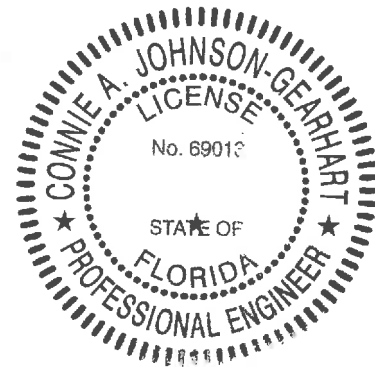

*Connie A. Johnson-Gearhart*  
**CONNIE A. JOHNSON-GEARHART, P.E.**  
Florida License No. 69013 7/2/25

This report contains information that is intended solely for the use of the client and noted assigns.  
This report shall not be reproduced, except in full, without written approval of Test Lab, Inc.