



GEOTECHNICAL & MATERIALS
ENGINEERING, TESTING & INSPECTION

P.O. BOX 15732 • TAMPA, FLORIDA 33684 • 813/872-7821 CA No. 1450

AGGREGATE ANALYSIS

PROJECT: Product Check

PROJECT NO: 1505.21.1

CLIENT: Pasco Mine

DATE: 7/1/2025

LAB NO.: B-15430

SAMPLE LOCATION: Stockpile

SAMPLE DESCRIPTION: Coarse Aggregate – No. 89 Limestone

<u>Sieve Number</u>	<u>Percent Passing</u>	<u>FDOT Specifications</u> <u>Section 901-1.4</u>
1/2"	100	100
3/8"	100	90-100
No. 4	12	20-55
No. 8	8	0-30
No. 16	7	0-10
No. 30	7	---
No. 50	6	0-5
No. 100	6	---
No. 200	4.5	---

FINENESS MODULUS: 5.55


DATE SAMPLED: 6/20/2025

DATE RECEIVED: 6/20/2025

DATE TESTED: 6/30/2025

SAMPLED BY: CB

TESTED BY: CB

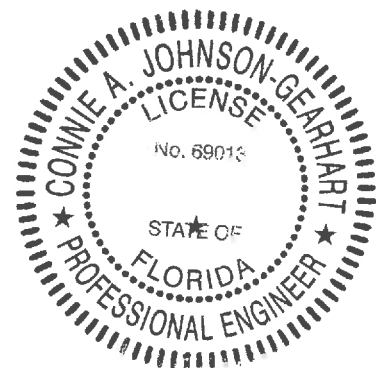

Connie A. Johnson-Gearhart

CONNIE A. JOHNSON-GEARHART, P.E.
Florida License No. 69013

7/2/25